

AN ISO 9001:2015 Certified Company

Address: 5-24-1223/8/1, Ambadkar Nagar, Gajularamaram, Hyderabad - 500055.

AN ISO 9001:2015 Certified Company Contact No: 9652998932

Contact No: 9652998932 GSTIN: 36GNLPS1299P1ZS


Email: sandhyaprises@ gmail.com Website www.sandhyaflex.com

WhatsApp: 9652998932


YouTube: www.youtube.com/c/SANDHYAENTERPRISES

Website : http://www.sandhyaflex.com/pvc-water-

Request a Quote: https://www.sandhyaflex.com/contactus-1.php



SECTIONAL DETAILS OF DOUBLE HOLLOW BULB DAM GATE SEAL

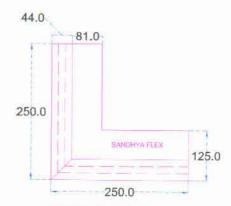

DETAILS OF MOULDED CORNER SEAL



SECTIONAL DETAILS OF FLAT TYPE SEAL All dimensions are in millimeter



| S.NO | TESTS | Permissible Limits as per IS:11855-1986 Specification | Relevant code for testing procedure/method | | |
|------|---|--|--|--|--|
| 1 | Physical Properties-Before Ageing | | | | |
| | Hardness Test | 60 to 70 Shore A | IS:3400(Part II) | | |
| | Tensile Strength | 14.5 N/MM2 (Min) | IS:3400(Part I) | | |
| | Elongation at Break | 450%(min) | IS:3400(Part I) | | |
| 2 | Water Absorbtion | 10% (max) | IS:3400(Part VI) | | |
| 3 | Polymer Percentage | 70%(min) | IS:3400(Part XXII) | | |
| 4 | Polymer | (NR) | ASTM D297 | | |
| 5 | Physical Properties - After Ageing @ 70o C for 48 Hours | | | | |
| | Changing in Tesile Stregth % | +20%(Max) | IS:3400(Part IV) | | |
| | Change in Tensile Strength % | -20%(Max) | IS:3400(Part IV) | | |
| | Change in Elongation at Break | -20%(Max) | IS:3400(Part IV) | | |

| TITLE: | DRAWING NO: | DRAWN BY: MD. RAHMATH ALI | |
|---|--------------------------|--|-----|
| DAM GATE RUBBER SEAL (DOUBLE HOLLOW BULB) | SE/RS/L125/BD44/HD19/T14 | (B.TECH CIVIL ENG) CHECKED BY: MITHILESH CHOUDHARY | 101 |





AN ISO 9001:2015 Certified Company

Address: 5-24-1223/8/1, Ambedkar Nagar, Gajularamaram, Hyderabad - 500055.

AN ISO 9001:2015 Certified Company

Contact No: 9652998932 GSTIN: 36GNLPS1299P1ZS


Email: sandhyaprises@ gmail.com Website: www.sandhyaflex.com

WhatsApp: 9652998932

YouTube: www.youtube.com/c/SANDHYAENTERPRISES

Website: http://www.sandhyaflex.com/pvc-water-

Request a Quote: https://www.sandhyaflex.com/contactus-1.php



SECTIONAL DETAILS OF DOUBLE HOLLOW BULB DAM GATE SEAL



SECTIONAL DETAILS OF FLAT TYPE SEAL 250.0 SANDHYA FLEX 100.0 -250.0 DETAILS OF MOULDED

44.0

DETAILS OF MOULDED CORNER SEAL





| S.NO | TESTS | Permissible Limits as per IS:11855-1986 Specificatoin | Relevant code for testing procedure/method | | |
|------|---|--|--|--|--|
| 1 | Physical Properties-Before Ageing | | | | |
| | Hardness Test | 60 to 70 Shore A | IS:3400(Part II) | | |
| | Tensile Strength | 14.5 N/MM2 (Min) | IS:3400(Part I) | | |
| | Elongation at Break | 450%(min) | IS:3400(Part I) | | |
| 2 | Water Absorbtion | 10% (max) | IS:3400(Part VI) | | |
| 3 | Polymer Percentage | 70%(min) | IS:3400(Part XXII) | | |
| 4 | Polymer | (NR) | ASTM D297 | | |
| 5 | Physical Properties - After Ageing @ 70o C for 48 Hours | | | | |
| | Changing in Tesile Stregth % | +20%(Max) | IS:3400(Part IV) | | |
| | Change in Tensile Strength % | -20%(Max) | IS:3400(Part IV) | | |
| | Change in Elongation at Break | -20%(Max) | IS:3400(Part IV) | | |

| TITLE: | DRAWING NO: | DRAWN BY: MD. RAHMATH ALI | | CAMBRILLA PAURPRIBLOPO |
|---|--------------------------|--|---|-------------------------------|
| DAM GATE RUBBER SEAL (DOUBLE HOLLOW BULB) | SE/RS/L100/BD44/HD19/T14 | (B.TECH CIVIL ENG) CHECKED BY: MITHILESH CHOUDHARY | 5 | SANDHYA ENTERPRISES HYDERABAD |



AN ISO 9001:2015 Certified Company

Address: 5-24-1223/8/1, Ambedkar Nagar, Gajularamaram, Hyderabad - 500055.

AN ISO 9001:2015 Certified Company

Contact No: 9652998932 GSTIN: 36GNLPS1299P1ZS


Email: sandhyaprises@gmail.com Website www.sandhyaflex.com

WhatsApp: 9652998932


YouTube: www.youtube.com/c/SANDHYAENTERPRISES

Website: http://www.sandhyaflex.com/pvo-water-

Request a Quote: https://www.sandhyaflex.com/contactus-1.php

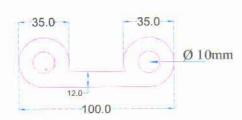

SECTIONAL DETAILS OF DOUBLE HOLLOW BULB DAM GATE SEAL

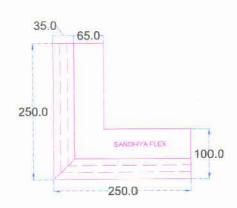

DETAILS OF MOULDED CORNER SEAL



All dimensions are in millimeter



SECTIONAL DETAILS OF FLAT TYPE SEAL

| S.NO | TESTS | Permissible Limits as per IS:11855-1986 Specificatoin | Relevant code for testing procedure/method | | |
|------|---|--|--|--|--|
| 1 | Physical Properties-Before Ageing | | | | |
| | Hardness Test | 60 to 70 Shore A | IS:3400(Part II) | | |
| | Tensile Strength | 14.5 N/MM2 (Min) | IS:3400(Part I) | | |
| | Elongation at Break | 450%(min) | IS:3400(Part I) | | |
| 2 | Water Absorbtion | 10% (max) | IS:3400(Part VI) | | |
| 3 | Polymer Percentage | 70%(min) | IS:3400(Part XXII) | | |
| 4 | Polymer | (NR) | ASTM D297 | | |
| 5 | Physical Properties - After Ageing @ 70o C for 48 Hours | | | | |
| | Changing in Tesile Stregth % | +20%(Max) | IS:3400(Part IV) | | |
| | Change in Tensile Strength % | -20%(Max) | IS:3400(Part IV) | | |
| | Change in Elongation at Break | -20%(Max) | IS:3400(Part IV) | | |

| TITLE: | DRAWING NO: | DRAWN BY: MD. RAHMATH ALI | | |
|--|--------------------------|------------------------------|---|----------------------------------|
| DAM GATE RUBBER SEAL (DOUBLE HOLLOW BULB) | SE/RS/L100/BD35/HD10/T12 | (B.TECH CIVIL ENG) | 5 | SANDHYA ENTERPRISES HYDERABAD |